



TVRC Errata Item

1 Errata Item Details

Title	Correction of LLCP version number
Certification Release(s) affected	CR9 & CR10
TVRC Errata Item ID	TVRC-EE103
Date Received	2016-12-13
TVRC ID	EE103
Date Resolved	2016-12-13
CC/TWG Kavi Comment Reference	n/a
TWG Change Request (CR)	testingwg.00484.2016.LLCP Version.000.docx

2 Document Details

TC Document Name	Test Cases for LLCP v1.2.01
TC Document Date	2016-12-02
TC Document Status	Published



3 Issue Summary

Functionality Area/Subject	LLCP 1.2 test cases
Test Case ID	TC_MAC_INI_BV_01 TC_MAC_INI_BV_02 TC_MAC_INI_BI_03 TC_MAC_INI_BI_02 TC_MAC_INI_BV_04 TC_MAC_INI_BV_05 TC_MAC_INI_BV_06 TC_MAC_INI_BV_07 TC_MAC_INI_BV_08
Subcase	n/a
Scenario(s)	n/a
Step(s)	n/a

4 Issue Description

It has been identified that in nine (9) test cases, the LT sends wrong LLCP version in the ATR_RES.



5 Approved Resolution

For all the test cases;

TC_MAC_INI_BV_01
 TC_MAC_INI_BV_02
 TC_MAC_INI_BI_03
 TC_MAC_INI_BI_02
 TC_MAC_INI_BV_04
 TC_MAC_INI_BV_05
 TC_MAC_INI_BV_06
 TC_MAC_INI_BV_07
 TC_MAC_INI_BV_08

the step two (2) shall be corrected in below manner

Scenario TC_MAC_INI_BV_01.A MAC Link Activation Procedure for the Initiator		
Step	Exchanges	Comments
1	IUT ► 'D4' + '00' + NFCID3 _I + '00'(DID _I) + '00'(BS _I) + '00'(BR _I) + 00b + 11b (LR _I) + 00b + 10b(PP _I) + "46666D" + LLC Parameter TLVs ► LT	ATR_REQ, no DID, max payload is 254 bytes, no NAD, and general bytes available. Verify that the LLC Parameter TLVs do not contain additional bytes.
2	IUT ◀ 'D5' + '01' + NFCID3 _T + '00'(DID _T) + '00'(BS _T) + '00'(BR _T) + '0A(TO) + '32'(PP _T) + "46666D" + " 0101110101XX " <u>See LLCP Technical Specification Version"-(VERSION)</u> + "03020003" (WKS) + "040164" (LTO) + "070103" (OPT) ◀ LT	ATR_RES, no DID, max payload is 254 bytes, no NAD, and general bytes available. Max WT.

6 Document Updates to be Applied

[Test Cases for LLCP v1.2.01](#)

7 Information to the Authorized Labs

n/a



8 Information to the CA

n/a